INSTALLATION REPORT

DataMaster DMT: 100136
Location: Montpelier PD
Calibration Date: 11/14/2011
Certification Date: 11/14/2011
Installation Date: 12/06/2011
Installed by: STEVEN E HARNOIS

Site meets specification in doc P-ALC-210

Default Options Loaded

Diagnostic Results

```
VERSIONS
DMT: 1.01
PIC: 2.05
Modem: 2.2
Questions: 2.0

TEMPERATURES

Sample Chamber = 48.9°C
Breath Tube    = 47.7°C
Digital Sim    = 33.9°C

SETTINGS
Lamp Voltage   = 1.80 V
Cooler Voltage = 1.79 V
Bias Voltage   = 80 V
Chopper Freq   = 530 Hz

PUMP INFO
Flow Rate = 5.995 L/M

DETECTOR INFO
PUMP     ON        OFF
MAX(V)   -0.0104   -0.0077
MIN(V)   -0.0116   -0.0087

FILTER INFO
Filter 1  -0.008  Zero = true
Filter 2   0.432  Zero = true
Filter 3   1.335  Zero = true

CALIBRATION CHECK
Xq  = 0.082  1.05%
```

Accuracy and Precision Check

Concentration	= 0.101 g/210L
Lot #	= 12-38-100
Range	= 0.096 - 0.106
Average	= 0.100 g/210L
Std Dev	= 0.0000

RF Detection Test

Passed

Sample Acceptance Test

Passed

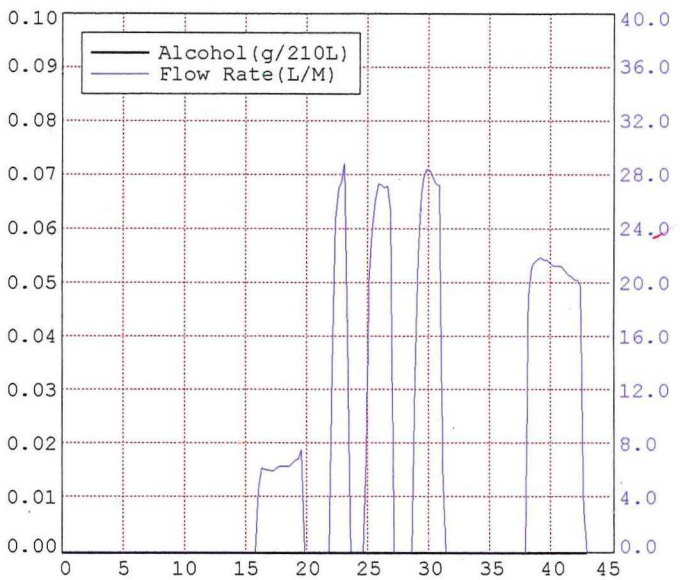

INSTALLATION PASSED

Performed by _____ Date 12/06/2011 Rev. 12-6-11

Reviewed by _____ Date 12/06/11

INSTALLATION REPORT

DataMaster DMT: 100136
Location: Montpelier PD
Calibration Date: 11/14/2011
Certification Date: 11/14/2011
Installation Date: 12/06/2011
Installed by: STEVEN E HARNOIS

Site meets specification in doc P-ALC-210

Default Options Loaded

Diagnostic Results

VERSIONS
DMT: 1.01
PIC: 2.05
Modem: 2.2
Questions: 2.0

TEMPERATURES

Sample Chamber = 49.0°C
Breath Tube = 48.1°C
Digital Sim = 33.9°C

SETTINGS
Lamp Voltage = 1.80 V
Cooler Voltage = 1.79 V
Bias Voltage = 80 V
Chopper Freq = 530 Hz

PUMP INFO
Flow Rate = 5.990 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX(V)	-0.0191	-0.0159
MIN(V)	-0.0203	-0.0171

FILTER INFO

Filter 1	-0.016	Zero = true
Filter 2	0.422	Zero = true
Filter 3	1.323	Zero = true

CALIBRATION CHECK
Xq = 0.082 1.05%

Accuracy and Precision Check

Concentration	= 0.101 g/210L
Lot #	= 12-38-100
Range	= 0.096 - 0.106
Average	= 0.100 g/210L
Std Dev	= 0.0000

RF Detection Test

Passed

Sample Acceptance Test

Failed
hit incorrect button

SEM 12/06/11
12/06/11

SH: Hit NO 12-6-11

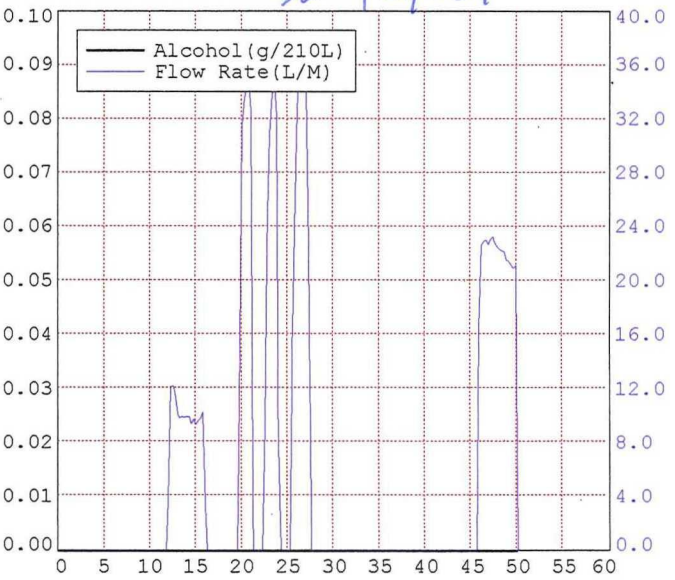

INSTALLATION FAILED

Performed by _____ Date 12/06/2011

Reviewed by _____ Date 12/06/11