VERMONT FORENSIC LABORATORY

PO BOX 47
WATERBURY, VERMONT 05676-0047
TEL: 802-244-8788
FAX: 802-241-5557
http://vfl.vermont.gov

DATAMASTER TECHNICAL SUPPORT INQUIRY

Agency/Site: Orleans County SO **DataMaster Serial #:** 103406

Date: 7/16/2014 Requestor: Philip Brooks

Instrument Supervisor: Philip Brooks Phone #: (802) 334-3333

Taken By: Rob Driscoll

Problem: DataMaster will not power up.

Laboratory Response: DMT technician will troubleshoot on site.

Work Performed: DataMaster DMT was found powered down. Voltage was present from the line conditioner, but no power output from the instrument's power supply. Brought the instrument to the VFL where the power supply was replaced with a new spare. Ran an Accuracy & Precision check to verify the instrument's performance. Instrument ready to be installed at agency.

☐ On Site ☒ In-house Attachments: 1 page

Performed By: Rob Driscoll RCD Date: 7/17/2014
Final Review: [signature] Date: 7/17/2014

ACCURACY & PRECISION REPORT

STATE OF VERMONT

DataMater DMT: 103406
Location: Orleans County SO

Date: 07/17/2014
Time: 07:28:23

SUPERVISOR NAME:
ROBERT DRISCOLL

SOLUTION LOT #: 13-22-100
SOLUTION CONCENTRATION: 0.099

BLANK TEST	0.000	07:29
CALIBRATION CHECK	PASSED	07:29
SIMULATOR VAPOR 34.1°C	0.098	07:29
SIMULATOR VAPOR 34.0°C	0.099	07:30
SIMULATOR VAPOR 34.0°C	0.099	07:31
SIMULATOR VAPOR 34.0°C	0.099	07:32
SIMULATOR VAPOR 34.0°C	0.099	07:33
SIMULATOR VAPOR 34.0°C	0.099	07:35
SIMULATOR VAPOR 34.0°C	0.099	07:36
SIMULATOR VAPOR 34.1°C	0.099	07:37
SIMULATOR VAPOR 34.0°C	0.099	07:38
SIMULATOR VAPOR 34.0°C	0.099	07:39
BLANK TEST	0.000	07:40

Average = 0.098
Std Dev = 0.000

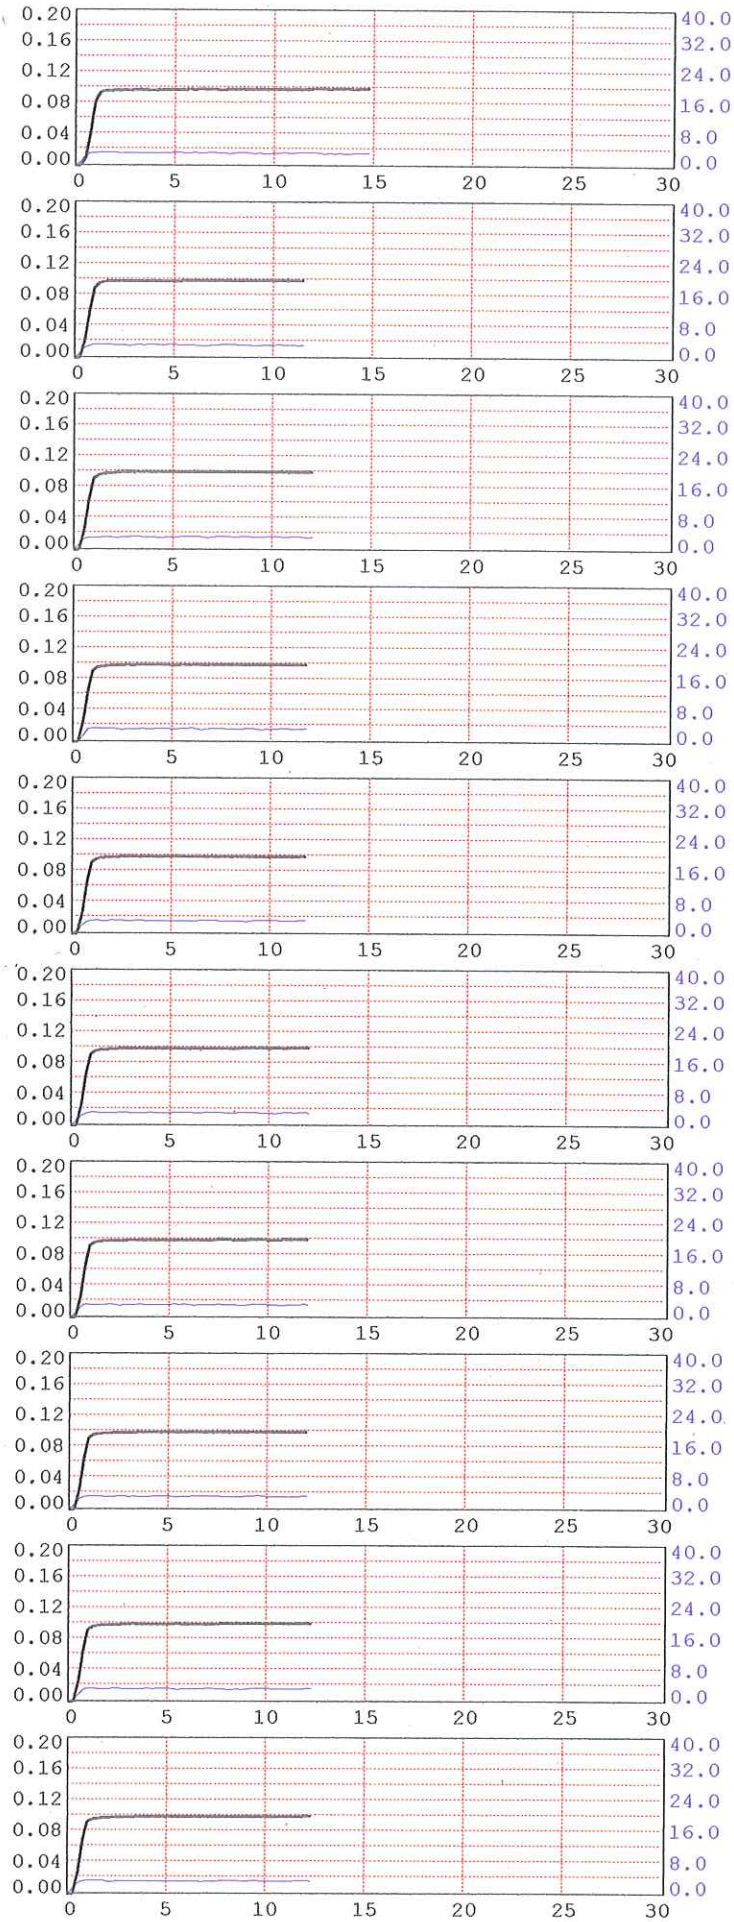

2 of 2 RCD