

2022 School Facilities Inventory Report

Facility Name: **NORTH COUNTRY SU | NEWPORT TOWN SCHOOL | 4212 VT ROUTE 105, NEWPORT CENTER 5857 - Combination - Main Building**

March 29, 2022


Total Value of Assets (Does Not Include Site/Structure/Walls/Interiors) **\$1,432,974**



GPS: 44.95178250693052, -72.30672951717372




Site Plan - Google Earth

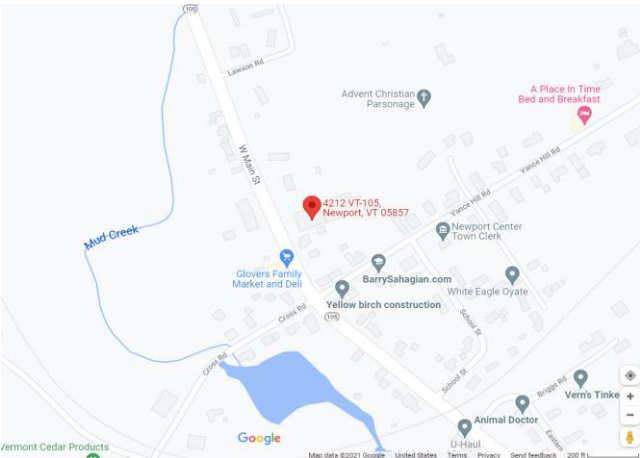


Location Plan - Google Maps

Relative Asset Values

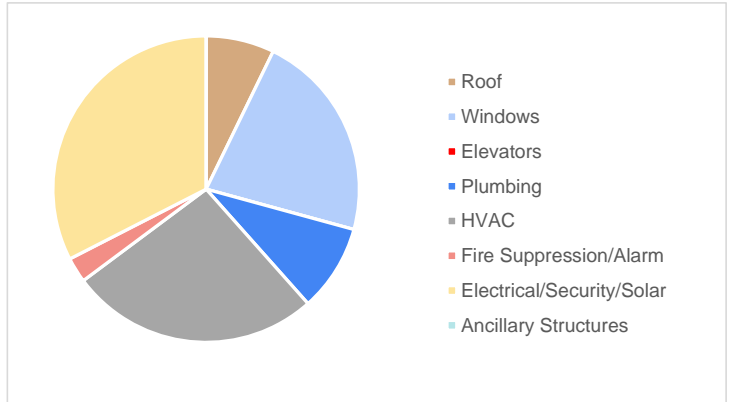


Value of Assets/GSF **\$76.25**

Projected Capital Planning Cash Flow

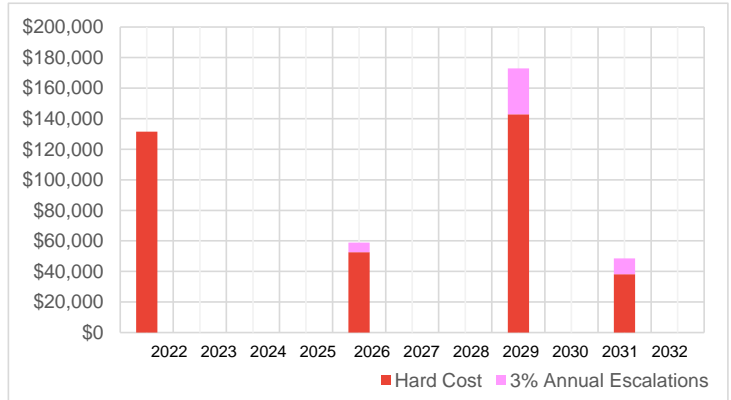

Facility Condition Index (FCI) Compared to Portfolio

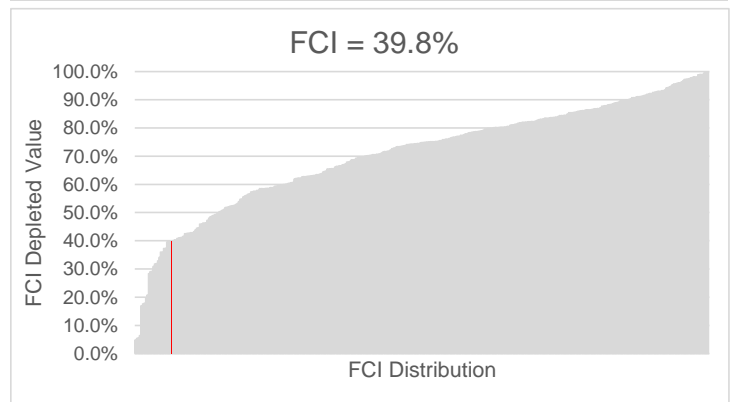

(See Last Page for Explanation of Terms)

2022 School Facilities Inventory Report

Facility Name: **NORTH COUNTRY SU | NEWPORT TOWN SCHOOL | 4212 VT ROUTE 105,
NEWPORT CENTER 5857 - Combination - Main Building**

Respondent Information

Date/Time Completed **2022-02-23 - 10:53 AM**
 Respondent Name **Theresa Miller**
 Respondent Title **Business and Finance/ Operations Support**
 Respondent Email **theresa.miller@ncsuvt.org**
 Respondent Phone Number **(802) 334-5847 x2012**

Facility Information

School Type **Combination**
 Building Identification **Main Building**
 Stories **1**
 Building Area **18794 (Gross Square Footage - GSF)**
 Year Constructed **1975**
 Year of Last Major Renovation **2009**
 FCI (Depleted Value) **39.8%**

Environmental & Safety Issues

Hazardous Materials **Yes** ⚠
 Hazardous (HZD) Materials include **Asbestos containing materials (ACM)**
 HZD Issues are **Minor**
 HZD Issues include **ACM in speech and learning center room fire doors**

Indoor Air Quality (IAQ) Issues **No**
 IAQ Issues include **-**
 IAQ Issues are **-**
 IAQ Issues include **-**

Fire or Life/Safety (FL/S) Issues **No**
 FL/S Issues are **-**

Other Risk Factors **Yes** ⚠
 Other Risk Factors include **The driveway is very short and we have a small window for pick up drop off**
 Other Risk Factors are **There are at times lines out around the corner on rte 105 waiting for kids to drop or pick up.**

Handicap Accessibility (ADA) Issues

Handicap Accessibility (ADA) Issues **Yes** ⚠
 ADA Issues are **Major**
 ADA Issues include **Pre-school and gym exits do NOT have a handicapped ground level exit or a handicapped ramp accessible.**

Utilities - Adequacy

IT / Internet Service **Adequate**
 Building Wi-Fi Coverage **Adequate**
 Cellular Reception **Inadequate** ⚠
 Water Service Pressure **Adequate**
 Natural Gas/Propane Pressure **Adequate**
 Electrical Capacity **Marginal** ⚠

2022 School Facilities Inventory Report

Facility Name: **NORTH COUNTRY SU | NEWPORT TOWN SCHOOL | 4212 VT ROUTE 105,
NEWPORT CENTER 5857 - Combination - Main Building**

Building Envelope - Roof

Roof 1 is Asphalt Shingle	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Covers 100%	30	26	\$5.50 / SF	18,794	SF	\$103,367
Installed in 2018						
Roof 2 is -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Covers 0%	-	N/A	- / -	-	-	\$0
Installed in -						
Roof 3 is -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Covers 0%	-	N/A	- / -	-	-	\$0
Installed in -						
Roof 4 is -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Covers 0%	-	N/A	- / -	-	-	\$0
Installed in -						

Building Envelope - Windows

Primary Window System Window, Wood-Frame	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
% of Windows That are this Type 100%	30	19	\$70.00 / SF	4,511	SF	\$315,739
Installed in 2011						
Secondary Window System -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
% of Windows That are this Type 0%	-	N/A	- / -	-	-	\$0
Installed in -						

Services - Elevators

Primary Conveyance/Elevators None	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Quantity of Stops 0	-	N/A	- / -	0	-	\$0
Installed in -						
Secondary Conveyance/Elevators -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Quantity of Stops 0	-	N/A	- / -	0	-	\$0
Installed in -						

Services - Plumbing

Primary Plumbing System Supply & Sanitary, Low Density (Includes Fixtures)	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 100%	40	-8	\$7.00 / GSF	18,794	GSF	\$131,558
Installed in 1974						
Secondary Plumbing System -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 0%	-	N/A	- / -	-	-	\$0
Installed in -						

Services - Cooling - Central System

Primary Central Cooling System None	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 0%	-	N/A	- / -	-	-	\$0
Installed in -						
Secondary Plumbing System -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 0%	-	N/A	- / -	-	-	\$0
Installed in -						

Services - Heating - Central System

Primary Heating System Boiler(s)/System - Fuel Oil	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 100%	30	13	\$60.00 / MBH	537	MBH	\$32,218
Installed in 2005						
Secondary Heating System -	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Area of building served 0%	-	N/A	- / -	-	-	\$0
Installed in -						

2022 School Facilities Inventory Report

Facility Name: **NORTH COUNTRY SU | NEWPORT TOWN SCHOOL | 4212 VT ROUTE 105,
NEWPORT CENTER 5857 - Combination - Main Building**

Services - HVAC Distribution

Primary HVAC Distribution System **Piped System to Unit Ventilators/Fan Coils, 2-Pipe System**

Area of building served	80%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2021	30	29	\$10.00 / GSF	15,035	GSF	\$150,352

Secondary HVAC Distribution System **Even Mix of Piped and Forced Air, 2-Pipe System**

Area of building served	20%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2012	30	20	\$14.00 / GSF	3,759	GSF	\$52,623

Services - Package Systems

Primary HVAC Package Unit & Splits **Even Mix of Package Units & Split Systems**

Area of building served	100%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2012	18	8	\$1,900.00 / TON	75	TON	\$142,834

Secondary HVAC Package Unit & Splits -

Area of building served	0%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	-	-	N/A	- / -	-	-	\$0

Services - Fire Suppression

Primary Fire Suppression System **Kitchen Hood or Computer Center Suppression System**

Area of building served	1 EA	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2012	20	10	\$10,000.00 / EA	1	EA	\$10,000

Secondary Fire Suppression System -

Area of building served	0%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	-	-	N/A	- / -	-	-	\$0

Services - Fire Alarm System

Primary Fire Suppression System **Older type Zoned System**

Area of building served	100%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2012	20	10	\$1.50 / GSF	18,794	GSF	\$28,191

Secondary Fire Suppression System -

Area of building served	0%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	-	-	N/A	- / -	-	-	\$0

Services - Security Systems

Primary Security & Low Volt System **Security & Low Voltage Systems - Average**

Area of building served	70%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2012	15	5	\$4.00 / GSF	13,156	GSF	\$52,623

Secondary Security & Low Volt System -

Area of building served	0%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	-	-	N/A	- / -	-	-	\$0

Services - Electrical Distribution/Infrastructure

Electrical Distribution/Infrastructure **Main Distribution Panel w/Sub Panels and Generator/UPS - Medium Density**

Area of building served	100%	EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
Installed in	2009	40	27	\$22.00 / GSF	18,794	GSF	\$413,468

Services - Solar Power (PV)

Solar (Electric Generation) Provided **None**

Owned/Maintained by School -

Quantity of Panels 0

Installed in -

Value of Solar PV Panels: -

EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
-	N/A	- / -	-	-	\$0

Ancillary Structures

Ancillary Structures **None**

Total SF of Ancillary Structures -

Installed in -

EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
-	N/A	- / -	-	-	\$0

Secondary Ancillary Structures -

Total SF of Secondary Ancillary Structures 0

Installed in -

EUL	C-RUL	Cost / Unit	Quantity	Units	Total Value
-	N/A	- / -	-	-	\$0

Additional Comments

2022 School Facilities Inventory Report

Facility Name: **NORTH COUNTRY SU | NEWPORT TOWN SCHOOL | 4212 VT ROUTE 105,
NEWPORT CENTER 5857 - Combination - Main Building**

Explanation of Terms

Projected Capital Planning Cash Flow	The estimated replacement costs of systems as they expire annually.
Facility Condition Index (FCI)	The cost -weighted depleted value of the building compared to the total value of all its systems; overall percent of building useful life consumed by years in service.
Total Value of Assets	The total estimated replacement cost of all the assets listed in the form.
Value of Assets per GSF	The Total Value of all Assets in the form divide by the Gross Square Footage (GSF) of the building.
Facility Condition Index (FCI) Compared to Portfolio	The Facility Condition Index (FCI) of the building overlaid on the chart of FCI's for all buildings in the portfolio. Indicated by a red line in the chart.
Calculated Remaining Useful Life(C-RUL)	The current number of remaining years a system may be expected to perform in designed service.
Expected Useful Life (EUL)	The total number of years a system can be expected to perform in designed service when new.
Gross Square Footage (GSF)	The total square footage contained within the building for all floors/levels.
Cost per Unit	The estimated base cost for a single unit of a system. When multiplied by Quantity results in the total system cost.
Quantity	The amount of a system present in a building. When multiplied by the Cost per Unit results in the total system cost.
Units	The expressed unit of measure for a given system (GSF, EACH, TON, etc).
Ancillary Structures	Buildings on site that are typically known as portables, relocatables or temporary buildings.