



MEMORANDUM

TO: ORANGE COUNTY STATE'S ATTORNEY WILL PORTER
FROM: AMANDA BOLDUC, ALCOHOL SECTION SUPERVISOR
SUBJECT: ORANGE COUNTY SHERIFF'S DEPARTMENT DMT
DATE: 5/17/16
CC: GREG NAGURNEY, SHERIFF BILL BOHNYAK

A handwritten signature in blue ink, appearing to be "AB", is written over the "FROM" and "SUBJECT" lines of the memorandum.

On 5/4/16, the DMT Supervisor (Deputy Briggs) for the Orange County Sheriff's Department (OCSD) contacted the Vermont Forensic Laboratory's (VFL) DMT Technician (Rob Driscoll) and informed him that their DMT (102906) had been reporting "Simulator Time Out" errors. On 5/9/16, Rob requested that Deputy Briggs perform an Accuracy and Precision (A&P) test and inspect the simulator for leaks. Deputy Briggs attempted the A&P test which failed due to the same error. He then performed a Simulator Solution Change, which passed. Based on the previous failures reported, Rob went to OCSD on 5/11/16 to inspect the instrument. Upon arrival, he noticed that the DMT had been moved to an adjacent room around the corner from its previous location. VFL procedures dictate that any move beyond the length of the power cord of the instrument (i.e. the instrument would need to be unplugged) requires VFL notification. When an instrument is sited in a location, a site evaluation checklist is completed and an Installation protocol is performed on the instrument to ensure the site and unit are fit for service.

VFL records indicate that on 10/6/15, the VFL DMT Technician performed an Annual Preventative Maintenance check on DMT 102906. At that time, the DMT was in the original location it had been in since the initial installation. According to an email from Deputy Briggs, the DMT was moved on 10/8/15. On 5/11/16, Rob performed a site inspection for the new location of the instrument. He also performed an Installation protocol in accordance with VFL procedures. He found no deficiencies in the location or the instrument. Further, on 2/3/16 Deputy Briggs performed a Routine Performance Check on the DMT instrument. The DMT software protocols for RPC and Installation are identical. The only difference between the two procedures is the addition of an external temperature check of the simulator performed using a NIST-traceable thermometer.

In the intervening months between when the instrument was moved and when the VFL DMT Technician performed the site evaluation, the instrument was used approximately one dozen times. A list of the subject tests performed in that period has been provided to the Orange County State's Attorney. Of those, there were 5 successful DUI subject tests which reported BrAC results and 3 refusals. All of the other attempts resulted in errors and no results were reported. These errors do not negate the accuracy, reliability or validity of the reported results. It is also concluded that the move of the instrument, while it violated VFL procedures, did not in any way cause the instrument to report inaccurate or unreliable results.

Attachments:

- 4- pages of email correspondence between Deputy Briggs and Rob Driscoll
- Annual Preventative Maintenance Report dated 10/6/15
- Routine Performance Check Report dated 2/3/16
- Simulator Solution Change Report dated 5/9/16
- 10- page Technical Support Inquiry dated 5/4/16
- Breath Test Summary for dates 10/8/15 – 5/16/16 generated by DMHost
 - This report does not include data generated on the DMT after 5/4/16. This instrument is not connected via Ethernet to DMHost therefore; only the data previous to the last manual data download is available despite the query date. The last data download was completed 5/4/16
- Breath Record History report generated on the DMT instrument for dates 5/4/16 - 5/17/16

Bolduc, Amanda

From: Driscoll, Rob
Sent: Tuesday, May 17, 2016 1:47 PM
To: Bolduc, Amanda
Subject: FW: DataMaster Move

From: Wayne Briggs [mailto:wbriggs@orangecountysheriff.com]
Sent: Tuesday, May 17, 2016 1:20 PM
To: Driscoll, Rob
Subject: RE: DataMaster Move

I'll send you a new copy miss read on my part. As for moving it I was sure I was within the cord distance as a straight line from its prior location, but I did not consider the fact of changing the outlet.

Wayne

On May 17, 2016 12:58 PM, "Driscoll, Rob" <Rob.Driscoll@vermont.gov> wrote:

Wayne,

The Breath Record History Report should allow you to enter a "start" and "end" date. Is that what you did for the report you sent? There may not be any entries after 5/4, but I want to make sure we cover the whole period between the two dates. Also, why was the VFL not notified of the instrument's move to the adjacent room? Any move further than the length of the power cord requires VFL Alcohol program staff to complete the move.

Thanks,
Rob

Robert Driscoll

Vermont Forensics Laboratory

45 State Drive

Waterbury, VT 05671

Electronics Technician

Rob.Driscoll@Vermont.gov

Desk: [\(802\) 241-5817](tel:8022415817)

Cell: [\(802\) 585-0123](tel:8025850123)

From: Wayne Briggs [mailto:wbriggs@orangecountysheriff.com]
Sent: Tuesday, May 17, 2016 7:39 AM
To: Driscoll, Rob
Subject: Re: DataMaster Move

Rob

Here is the one for 5/4 there is no breath history for 5/11.

Wayne

On Mon, May 16, 2016 at 2:18 PM, Driscoll, Rob <Rob.Driscoll@vermont.gov> wrote:

Ok. Thank you.

Rob

From: Wayne Briggs [mailto:wbriggs@orangecountysheriff.com]
Sent: Monday, May 16, 2016 2:14 PM

To: Driscoll, Rob
Subject: Re: DataMaster Move

I won't be back in the office until tomorrow, I will take care of it then if that works for you.

Wayne

On Mon, May 16, 2016 at 1:59 PM, Driscoll, Rob <Rob.Driscoll@vermont.gov> wrote:

Wayne,

Can you please run a Breath Record History for the following dates and send it to me?

5/4/16 to 5/11/16

Thanks,
Rob

From: Wayne Briggs [mailto:wbriggs@orangecountysheriff.com]

Sent: Monday, May 16, 2016 1:49 PM

To: Driscoll, Rob

Subject: Re: DataMaster Move

Sorry 10/8/2015.

On Mon, May 16, 2016 at 1:48 PM, Wayne Briggs <wbriggs@orangecountysheriff.com> wrote:

It was moved on 10/8/2016.

Wayne

On Mon, May 16, 2016 at 1:22 PM, Driscoll, Rob <Rob.Driscoll@vermont.gov> wrote:

Wayne,

Can you please tell me the date when you moved the DMT to its new location?

Thank you,

Rob

Robert Driscoll

Vermont Forensics Laboratory

45 State Drive

Waterbury, VT 05671

Electronics Technician

Rob.Driscoll@Vermont.gov

Desk: [\(802\) 241-5817](tel:(802)241-5817)

Cell: [\(802\) 585-0123](tel:(802)585-0123)

--

Senior Deputy Wayne Briggs

Orange County Sheriff Dept.

Phone [\(802\)685-4875](tel:(802)685-4875)

wbriggs@orangecountysheriff.com

ANNUAL PREVENTATIVE MAINTENANCE



DataMaster DMT: 102906
Location: Orange SO
Calibration Date: 10/22/2013
Certification Date: 10/22/2013
Installation Date: 10/23/2013
APM Date: 10/06/2015
Performed by: ROBERT DRISCOLL

Diagnostic Results

VERSIONS
DMT: 1.01
PIC: 2.06
Modem: 2.4
Questions: 2.1

TEMPERATURES

Sample Chamber = 48.8°C
Breath Tube = 47.3°C
Digital Sim = 34.0°C

SETTINGS

Lamp Voltage = 1.71 V
Cooler Voltage = 1.82 V
Bias Voltage = 120 V
Chopper Freq = 541 Hz

PUMP INFO

Flow Rate = 4.004 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX (V)	0.1016	0.1043
MIN (V)	0.1000	0.1024

FILTER INFO

Filter	Value	Zero
Filter 1	0.103	Zero = true
Filter 2	0.439	Zero = true
Filter 3	1.554	Zero = true

CALIBRATION CHECK

Xq = 0.139 1.50%

APM PASSED

Simulator Vapor Test


Concentration = 0.100 g/210L
Lot# = 15-06-100
Range = 0.095 - 0.105
Simulator Vapor = 0.096 g/210L

RF Detection Test

Passed

Sample Acceptance Test

Passed

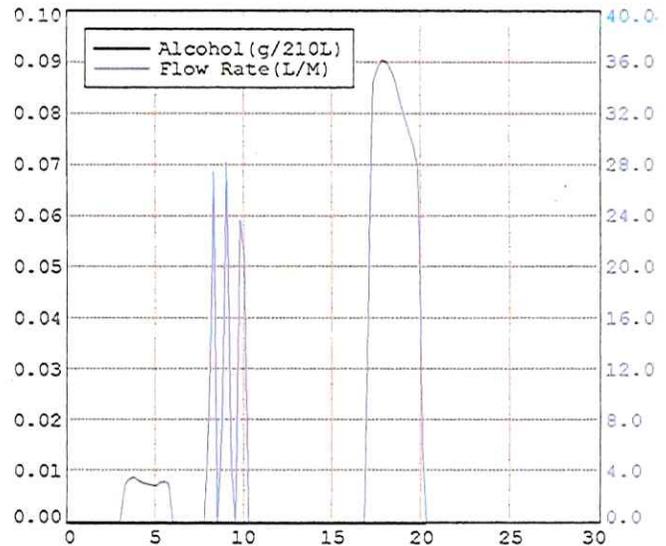

NIST Thermometer SN 111814517 34.0°C RCD
10/6/15

Performed by

RC

Date

10/06/2015

Reviewed by

AB

Date

10/20/15

ROUTINE PERFORMANCE CHECK REPORT



DataMaster DMT: 102906
Location: Orange SO
Calibration Date: 10/22/2013
Certification Date: 10/22/2013
Installation Date: 10/23/2013
RPC Date: 02/03/2016
Supervisor Name: WAYNE F BRIGGS

Diagnostic Results

VERSIONS
DMT: 2.00
PIC: 2.06
Modem: 2.6
Questions: 2.1

TEMPERATURES

Sample Chamber = 49.0°C
Breath Tube = 47.6°C
Digital Sim = 33.9°C

SETTINGS

Lamp Voltage = 1.71 V
Cooler Voltage = 1.81 V
Bias Voltage = 120 V
Chopper Freq = 542 Hz

PUMP INFO

Flow Rate = 3.983 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX (V)	0.1303	0.1323
MIN (V)	0.1287	0.1303

FILTER INFO

Filter	Value	Zero
Filter 1	0.131	true
Filter 2	0.463	true
Filter 3	1.577	true

CALIBRATION CHECK

Xg = 0.138 1.638

Routine Performance Check Passed

Accuracy and Precision Check


Concentration = 0.099 g/210L
Lot# = 15-13-100
Range = 0.094 - 0.104
Average = 0.097 g/210L
Std Dev = 0.0004

RF Detection Test

Passed

Sample Acceptance Test

Passed

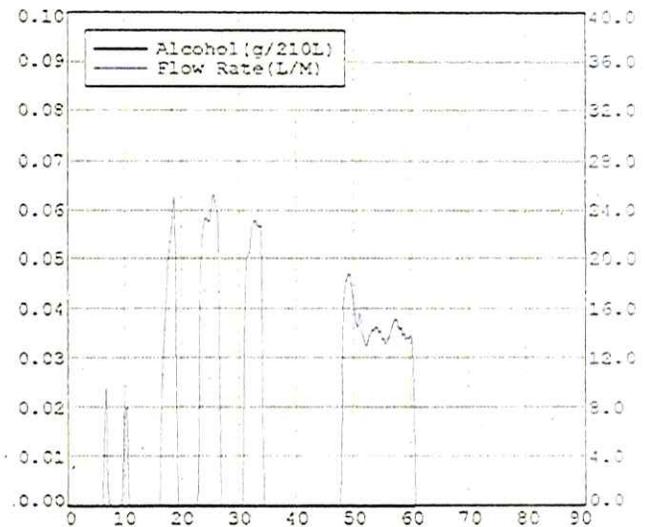

Performed by

Wayne F Briggs

Date

02/03/2016

Reviewed by

[Signature]

Date

2/3/16

DMT Serial Number #102906

Page 1 of 1

02/03/2016 3:07 PM

SOLUTION CHANGE

DataMaster DMT: 102906
Location: Orange SO
Date: 05/09/2016
Performed by: WAYNE F BRIGGS



Accuracy and Precision Check

Concentration = 0.099 g/210L
Lot # = 15-13-100
Range = 0.094 - 0.104
Average = 0.097 g/210L
Std Dev = 0.0005

*RCD
5/9/16*

Simulator Temperature: 33.9°C

Performed by Wayne F Briggs

Date 05/09/2016



VERMONT FORENSIC LABORATORY

PO BOX 47
WATERBURY, VERMONT 05676-0047
TEL: 802-244-8788
FAX: 802-241-5557
<http://vfl.vermont.gov>

DATAMASTER TECHNICAL SUPPORT INQUIRY

Agency/Site: Orange County SO DataMaster Serial #: 102906

Date: 5/4/2016 Requestor: Wayne Briggs

Instrument Supervisor: Wayne Briggs Phone #: _____

Taken By: Robert Driscoll

Problem: DMT Supervisor states that the instrument has had several "Simulator Timed Out" errors. _____

Laboratory Response: Asked DMT Supervisor to make sure the simulator jar and quick connects are fully tightened. He checked the connections and ran an A&P check. The A&P failed for a "Simulator Timed Out" error. He performed a solution change, which completed successfully. Alcohol program staff will inspect the instrument for any potential issues onsite.

Work Performed: Ran an Accuracy and Precision check and the instrument had a "Blank Error". Leak-checked the simulator and inspected the tubing and wiring inside the instrument for any abnormalities. While onsite, the line conditioner was upgraded to a newer model. Ran another A&P test and it was successful. Filled out a Site Evaluation form as the instrument was moved to an adjacent room and completed an installation protocol.

On Site In-house Attachments: 9 pages

Performed By: [Signature] Date: 5/11/2016
Final Review: [Signature] Date: 5/17/16

Page 1 of 10 R00

DPS - DMT

From: Wayne Briggs <wbriggs@orangecountysheriff.com>
Sent: Wednesday, May 04, 2016 3:30 PM
To: DPS - DMT
Subject: may 2016
Attachments: UP151006111352.zip; UP151006111307.zip; UP120831092204.zip; UP111109082003.zip; UP111026135907.zip; UP111019123506.zip; UP110928091238.zip; SU150220134718.zip; SU140210120818.zip; SU131205104636.zip; SU131022105313.zip; SU131022091914.zip; SU131022090447.zip; SU131022083536.zip; SU131021151800.zip; SU131021125452.zip; SU131021110117.zip; SU121019103031.zip; SU111026133932.zip; SU111026122833.zip; SU111026120911.zip; SU111026115307.zip; SU111026113824.zip; SU111026112453.zip; SU111026110235.zip; SU111026104327.zip; SU111026101750.zip; SU111026095233.zip; SU111026092811.zip; SU111026091407.zip; SU111026084329.zip; SU111025160635.zip; SU111025150946.zip; SU111025142846.zip; SU111025141154.zip; SU111025135012.zip; SU111025120012.zip; SU111025114458.zip; SU111025112932.zip; SU111025103336.zip; SU111021152154.zip; SU111021144058.zip; SU111021141531.zip; SU111021135709.zip; SU111021112417.zip; SU111021105616.zip; SU111020154049.zip; SU111020100834.zip; SU111020084723.zip; SU111020082814.zip; ST160504010521.zip; ST160504004312.zip; ST160504003934.zip; ST160412230523.zip; ST160229221707.zip; ST151217211853.zip; ST151114013229.zip; ST151003094759.zip; ST150401144040.zip; ST150213084328.zip; ST141220173942.zip; ST140915220449.zip; ST140116001902.zip; ST131129141121.zip; ST131127232902.zip; ST131110024145.zip; ST131106173313.zip; ST131105231513.zip; ST131105230649.zip; ST131105230344.zip; ST131023120058.zip; ST131017114920.zip; ST131017113717.zip; ST131017104737.zip; ST130816210703.zip; ST130716214437.zip; ST130628163803.zip; ST130220131444.zip; ST121019104855.zip; ST120331020631.zip; ST120229165743.zip; ST111231020240.zip; ST111020081258.zip; SO141222114319.zip; SO131205120033.zip; SO131108180748.zip; SO111231195100.zip; RP160203145605.zip; RP151003102244.zip; RP151003094018.zip; RP150601082315.zip; RP150401151942.zip; RP150401143307.zip; RP150213084420.zip; RP150213084328.zip; RP140918103023.zip; RP140627105639.zip; RP140210132616.zip; RP131017112325.zip; RP130625123722.zip; RP121019112720.zip; RP120628135839.zip; RP120229170225.zip; RP120229164303.zip; MA151006110044.zip; MA140918105015.zip; MA131017114645.zip; MA131017113607.zip; MA131017104404.zip; MA121019104453.zip; MA121019101955.zip; IN131023120231.zip; dmFactors.zip; DG151003090342.zip; DG150401135956.zip; DG140917141536.zip; DG131205112026.zip; DG131017115850.zip; DG130816222021.zip; DG130212103534.zip; DG111026111918.zip; DG111026105748.zip; DG111026094921.zip; DG111026082127.zip; DG111025134731.zip; DG111025090806.zip; DG111021162740.zip; DG111021135359.zip; DG111021104605.zip; DG111020095558.zip; DG111020091407.zip; DG110928091729.zip; CH160504150834.zip; CH151006112656.zip; CH150904132828.zip; CE131022110738.zip; CE111020160657.zip; CA131022085943.zip; CA131021151202.zip; CA131021105310.zip; CA111020081425.zip; CA111020081121.zip; BR160504010316.zip; BR160504004108.zip; BR160504003729.zip; BR160412232313.zip; BR160412230318.zip; BR160412224040.zip; BR160411012719.zip; BR160229224727.zip; BR160229221502.zip; BR151217211436.zip; BR151120003507.zip; BR151114013552.zip; BR151114012913.zip; BR150711051959.zip; BR150523010643.zip; BR150515183254.zip

Rob had an issue on the 3rd with the simulator timing out I did all the checks the manual suggested and everything was good,

Senior Deputy Wayne Briggs
Orange County Sheriff Dept.
Phone (802)685-4875
wbriggs@orangecountysheriff.com

NOTICE: This e-mail is covered by the Electronic Communications Privacy Act, 18 U.S.C. Sec. 2510-2521, is confidential and is legally privileged information. If you are not the intended recipient, including any and all administrative governmental staff, you are hereby notified that any viewing, retention, dissemination, distribution or copying of this communication is strictly prohibited. Please reply to the sender that you have received this message in error, then delete / destroy it.

Driscoll, Rob

From: Driscoll, Rob
Sent: Monday, May 09, 2016 9:37 AM
To: 'Wayne Briggs'
Subject: RE: Simulator Timed Out

Wayne,

Could you please run an Accuracy and Precision test and send us a copy as well?

Thanks,
Rob

Robert Driscoll
Vermont Forensics Laboratory
45 State Drive
Waterbury, VT 05671
Electronics Technician
Rob.Driscoll@Vermont.gov
Desk: (802) 241-5817
Cell: (802) 585-0123

From: Wayne Briggs [<mailto:wbriggs@orangecountysheriff.com>]
Sent: Monday, May 09, 2016 8:05 AM
To: Driscoll, Rob
Subject: Re: Simulator Timed Out

No maintenance logs for April, I'll get the operator log out this week.

On May 9, 2016 7:43 AM, "Driscoll, Rob" <Rob.Driscoll@vermont.gov> wrote:

Wayne,

I just received your message as I was out of town. Make sure the simulator is fully connected to the quick connects and that the jar is snug against the lid oring. If you don't have any issues running an Accuracy and Precision check, then you should be good to go. Also, I received your data, but I did not receive any copies of the Maintenance Log or Operator Use Logbooks? Did you not have any entries for April?

Regards,

Rob

Robert Driscoll

Vermont Forensics Laboratory

45 State Drive

Waterbury, VT 05671

Electronics Technician


Rob.Driscoll@Vermont.gov

Desk: [\(802\) 241-5817](tel:(802)241-5817)

Cell: [\(802\) 585-0123](tel:(802)585-0123)

Status Record History

Status Date	Status Time	Test Type	Status Message
02/13/2015	08:43:28	RPC Record	User Abort
04/01/2015	14:40:40	RPC Record	ACCURACY AND PRECISION CHECK FAILED
10/03/2015	09:47:59	RPC Record	ACCURACY AND PRECISION CHECK FAILED
11/14/2015	01:32:29	DUI Subject Record	RESPONSE TIMEOUT
12/17/2015	21:18:53	DUI Subject Record	Simulator Out of Range
02/29/2016	22:17:07	DUI Subject Record	Simulator Timed Out
04/12/2016	23:05:23	DUI Subject Record	Simulator Timed Out
05/04/2016	00:39:34	DUI Subject Record	Simulator Timed Out
05/04/2016	00:43:12	DUI Subject Record	Simulator Timed Out
05/04/2016	01:05:21	DUI Subject Record	Simulator Timed Out
05/09/2016	12:19:34	Accuracy & Precision Records	Simulator Timed Out
05/11/2016	11:40:50	Accuracy & Precision Records	Blank Error

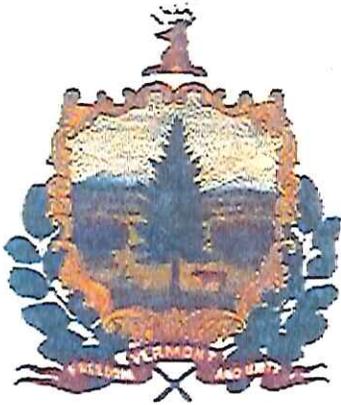

ACCURACY & PRECISION REPORT

STATE OF VERMONT

DataMaster DMT: 102906
Location: Orange SO


Date: 05/11/2016
Time: 11:44:38

SUPERVISOR NAME:
ROBERT DRISCOLL

SOLUTION LOT #: 15-13-100
SOLUTION CONCENTRATION: 0.099

BLANK TEST	0.000	11:45
CALIBRATION CHECK	PASSED	11:45
SIMULATOR VAPOR 34.0°C	0.097	11:46
SIMULATOR VAPOR 34.0°C	0.097	11:47
SIMULATOR VAPOR 34.0°C	0.097	11:48
SIMULATOR VAPOR 34.0°C	0.097	11:49
SIMULATOR VAPOR 33.9°C	0.097	11:50
SIMULATOR VAPOR 33.9°C	0.097	11:51
SIMULATOR VAPOR 34.0°C	0.098	11:52
SIMULATOR VAPOR 34.0°C	0.097	11:53
SIMULATOR VAPOR 34.0°C	0.098	11:54
SIMULATOR VAPOR 33.8°C	0.097	11:55
BLANK TEST	0.000	11:56

Average = 0.097
Std Dev = 0.0004

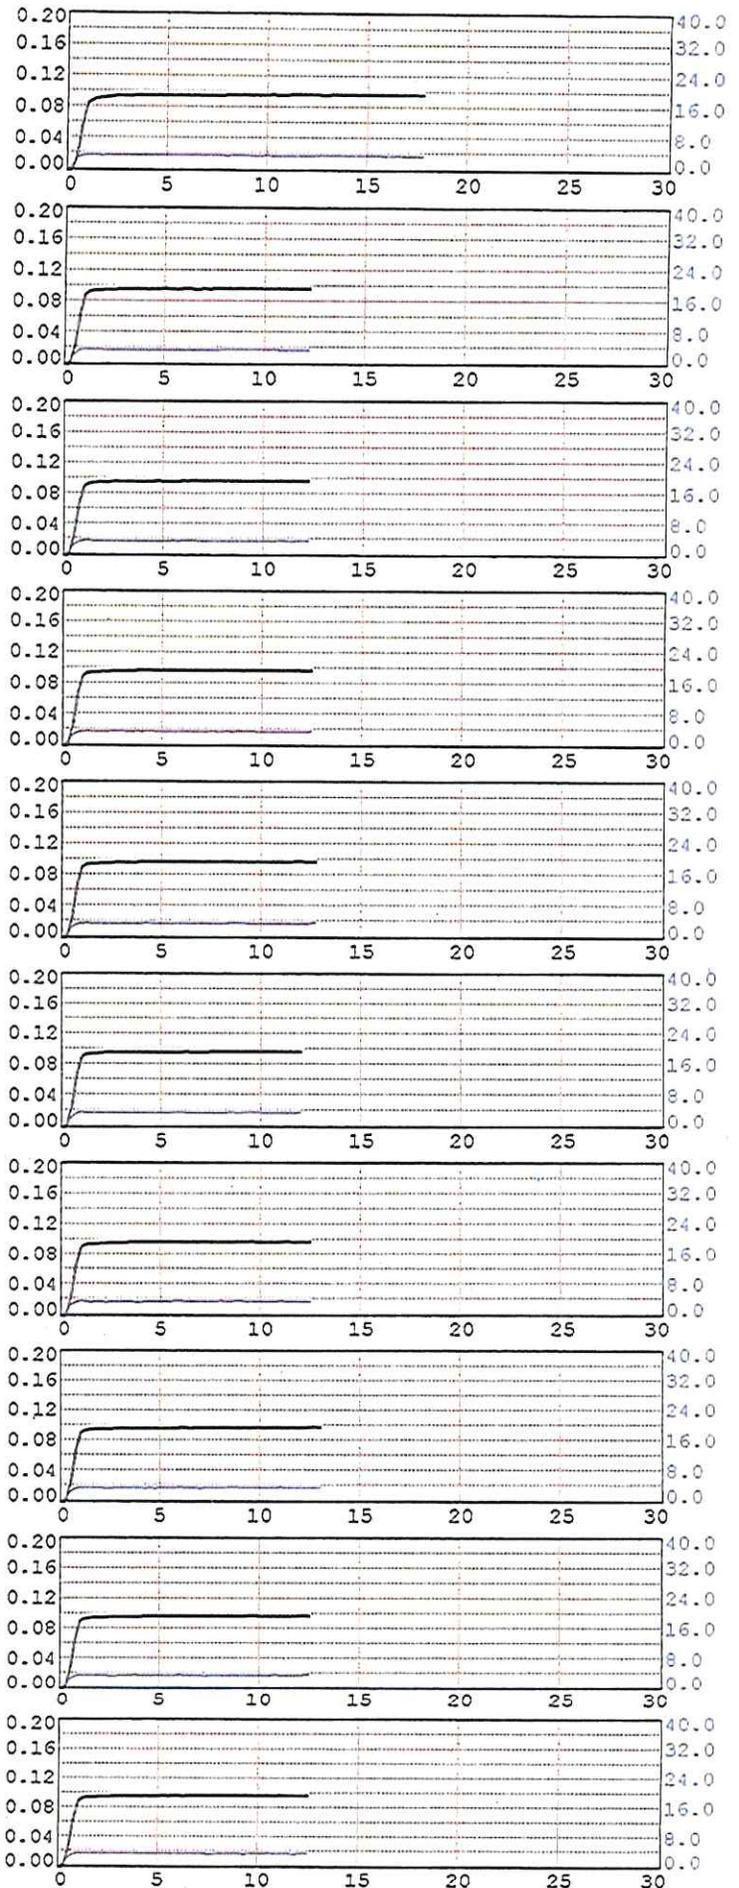

For 10 RCD



ACCURACY & PRECISION REPORT

STATE OF VERMONT

DataMaster DMT: 102906
Location: Orange SO






Date: 05/11/2016
Time: 11:34:33

SUPERVISOR NAME:
ROBERT DRISCOLL

SOLUTION LOT #: 15-13-100
SOLUTION CONCENTRATION: 0.099


TEST TYPE	Result	Time
BLANK TEST	0.000	11:35
CALIBRATION CHECK	PASSED	11:35
SIMULATOR VAPOR 34.0°C	0.098	11:36
SIMULATOR VAPOR 33.9°C	0.097	11:37
SIMULATOR VAPOR 34.0°C	0.098	11:38
SIMULATOR VAPOR 34.0°C	0.097	11:39
SIMULATOR VAPOR 34.0°C	0.096	11:40

Blank Error

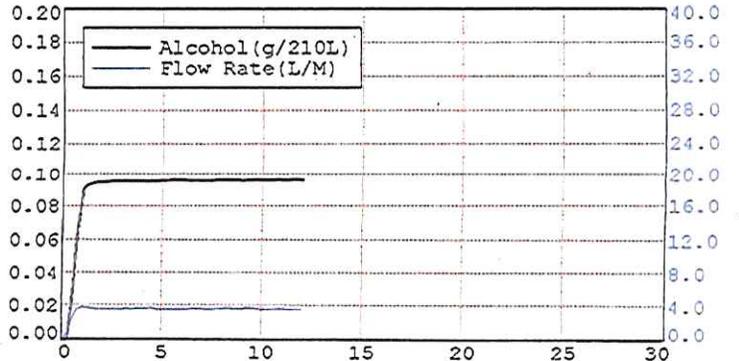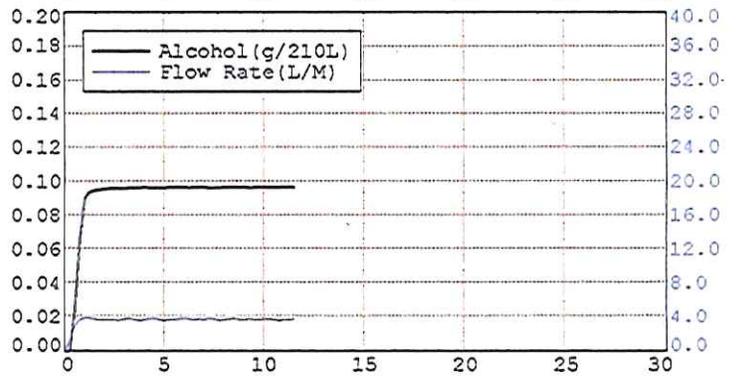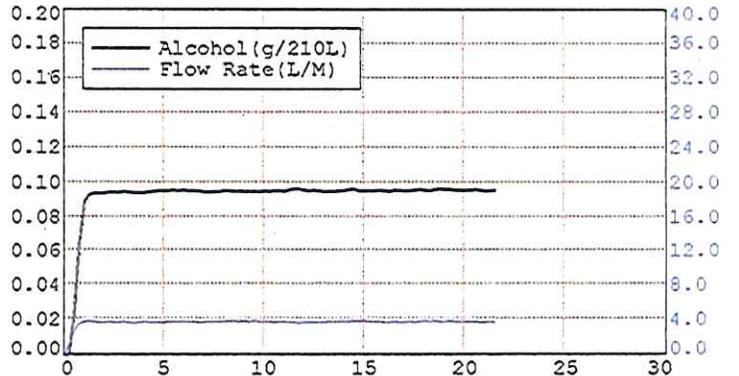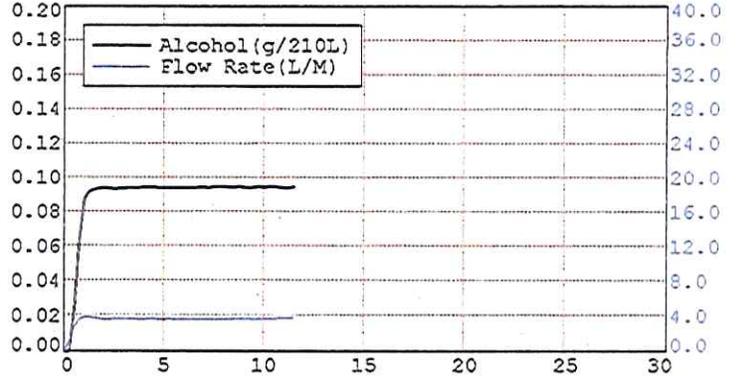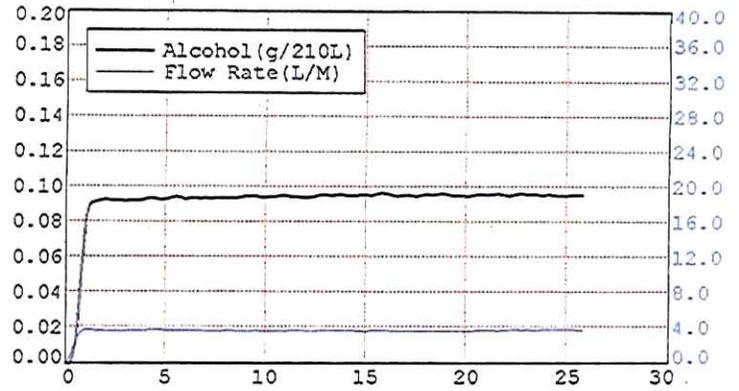

INSTALLATION REPORT

DataMaster DMT: 102906
Location: ORANGE SO
Calibration Date: 10/22/2013
Certification Date: 10/22/2013
Installation Date: 05/11/2016
Installed by: ROBERT DRISCOLL

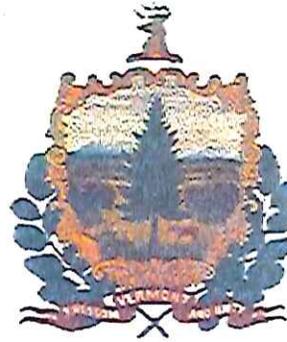

Default Options Loaded

Diagnostic Results

VERSIONS
DMT: 2.00
PIC: 2.06
Modem: 2.6
Questions: 2.1

TEMPERATURES

Sample Chamber = 48.9°C
Breath Tube = 48.1°C
Digital Sim = 33.9°C

SETTINGS

Lamp Voltage = 1.71 V
Cooler Voltage = 1.82 V
Bias Voltage = 120 V
Chopper Freq = 541 Hz

PUMP INFO

Flow Rate = 4.029 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX (V)	0.2031	0.2047
MIN (V)	0.2006	0.2031

FILTER INFO

Filter	Value	Zero
Filter 1	0.203	Zero = true
Filter 2	0.531	Zero = true
Filter 3	1.629	Zero = true

CALIBRATION CHECK

Xq = 0.139 1.57%

INSTALLATION PASSED

Accuracy and Precision Check


Concentration = 0.098 g/210L
Lot # = 16-04-100
Range = 0.093 - 0.103
Average = 0.097 g/210L
Std Dev = 0.0005

RF Detection Test

Passed

Sample Acceptance Test

Passed

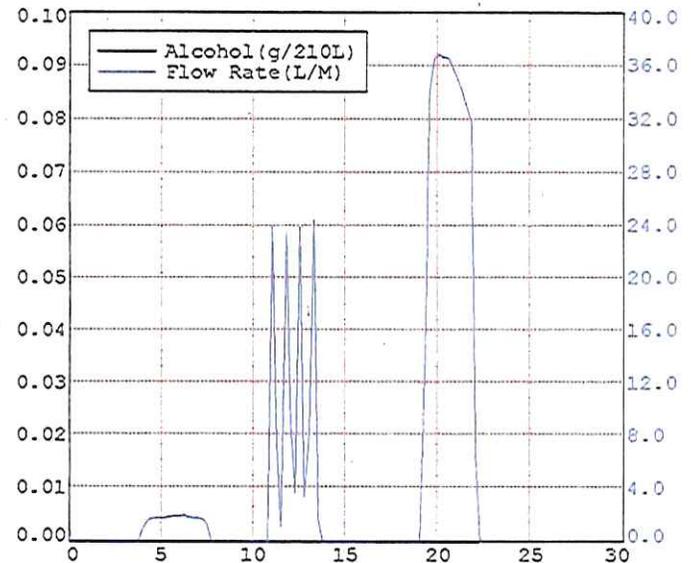

NEST Thermometer S/N 111214367 34.0°C

RCD
5/11/16

Performed by RB RCD

Date 05/11/2016

Reviewed by [Signature]

Date 5/17/16

VERMONT FORENSIC LABORATORY

PO BOX 47
 WATERBURY, VERMONT 05676-0047
 TEL: 802-244-8788
 FAX: 802-241-5557
<http://vfl.vermont.gov>



DataMaster DMT Site Evaluation Checklist

Agency or Site Information

Name: Orange County SO
 Address: 11 VT Rte 113
Chelsea, VT 05038
 Phone: (802) 685-4875
 Fax: (802) 685-3204

Personnel Information

Head of Site: Captain Kapitanski
 Current DataMaster Supervisor (s):
Wayne Briggs
Benjamin Herrick
 Proposed DataMaster Supervisor(s):

(Proposed) DataMaster DMT Environment

Limited Controlled Access: Y N
 Low Activity Area: Y N
 Unlimited Access by Other Law Enforcement Personnel: Y N
 Access by VFL Technical Services: Y N
 Air Conditioned: Y N
 Room Temperature 65° - 85° F: Y N
 Adequate Ventilation: Y N
 Free of Cleaning Supplies: Y N
 Clean: Y N

(Proposed) DataMaster DMT Connection(s)

Power: Y N
 Min 15 Amp
 Limited low power sharing: Y N
 Ethernet Available: Y N
 Distance to Ethernet: _____

(Proposed) DataMaster DMT Site Maintenance Agreement

Will notify VFL Alcohol Program staff of maintenance and supply needs promptly: Y N
 Will notify VFL Alcohol Program staff of changes in building conditions or moves promptly: Y N
 Will notify VFL Alcohol Program staff of relevant personnel changes at site promptly: Y N

VFL Representative: Robert D. D'Amico [Signature] 5/11/16
 Print Name Signature Date
 Agency Representative: Kyle Kapitanski [Signature] 5-11-16
 Print Name Signature Date

100-10 R3

State of Vermont
DMHost for Windows
Breath Test Summary

SerialNumber = '102906' and TestDate between '10/8/15' and '5/16/16'

Serial #	Test Date/Time	Sample 1	Sample 2	Sample 3	Sample 4	Sample 5	Sample 6	Sim 1	Sim T*	Sim 2	Sim T*	Sim Lot	Target	Status	Code
102906	11/14/2015 01:29							0.095	33.9			15-06-100	0.100	103	
102906	11/14/2015 01:35							0.095	33.9			15-06-100	0.100		
102906	11/20/2015 00:35	0.090						0.096	34.0			15-06-100	0.100		
102906	12/17/2015 21:14	0.069						0.095	33.9	0.094	33.9	15-06-100	0.100	11	
102906	02/29/2016 22:15											15-13-100		12	
102906	02/29/2016 22:47	0.096						0.095	33.8	0.095	33.9	15-13-100	0.099		
102906	04/11/2016 01:27	0.166						0.096	34.0			15-13-100	0.099		
102906	04/12/2016 22:40							0.097	34.0			15-13-100	0.099		
102906	04/12/2016 23:03		R									15-13-100		12	
102906	04/12/2016 23:23	0.064						0.096	33.9	0.096	34.0	15-13-100	0.099		
102906	05/04/2016 00:37											15-13-100		12	
102906	05/04/2016 00:41											15-13-100		12	
102906	05/04/2016 01:03											15-13-100		12	

End of Report

Breath Record History

Test Date	Test Time	Agency	Operator Name	Alcohol Val. 1	Alcohol Val. 2	Sim. Conc. 1	Sim. Conc. 2	Status Message
05/04/2016	00:37:29	ORANGE SO	JEAN-MIGUEL R BARTTEAU					Simulator Tired Out
05/04/2016	00:41:08	ORANGE SO	JEAN-MIGUEL R BARTTEAU					Simulator Tired Out
05/04/2016	01:03:16	ORANGE SO	JEAN-MIGUEL R BARTTEAU	0.000		0.095		Simulator Tired Out
05/04/2016	15:08:34	ORANGE SO	WAYNE F BRIGGS					
05/09/2016	20:22:15	ROYALTON VSP	MARK A BUSIER	INCOMPLETE	REFUSED	0.098		