

## 2022 School Facilities Inventory Report



Facility Name: COLCHESTER SD | PORTERS POINT SCHOOL | 490 PORTERS POINT RD,

COLCHESTER 5446 - Elementary (PreK thru 4) - Main Building

March 29, 2022

Total Value of Assets (Does Not Include Site/Structure/Walls/Interiors) \$2,093,005



GPS: 44.541426540109626, -73.25538317596084




Site Plan - Google Earth




Location Plan - Google Maps


Relative Asset Values

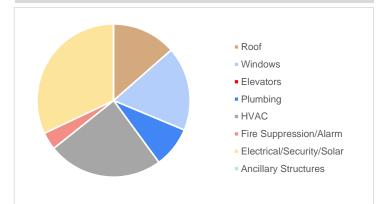

Value of Assets/GSF \$81.17

### Projected Capital Planning Cash Flow

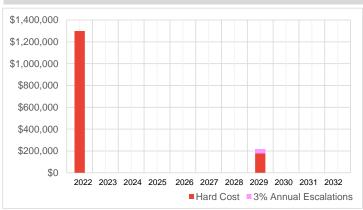

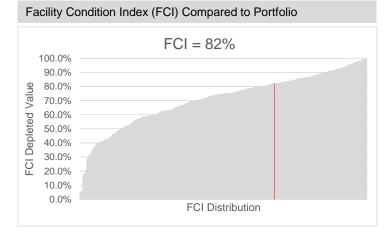

(See Last Page for Explanation of Terms)





2022 Caless I	and a state to a		Description
2022 School	Facilities	inventory	/ Keport

Facility Name:	COLCHESTER SD   PORTERS POINT SCHOOL   490 PORTERS POINT RD,			
	COLCHESTER 5446 - Elementary (PreK thru 4) - Main Building			
Respondent Information				
Date/Time Completed	2021-12-09 - 12:35 PM			
Respondent Name	George Trieb			
Respondent Title	Business and Operations Manager			
Respondent Email	george.trieb@colchestersd.org			
Respondent Phone Number	(802) 264-5979			
Facility Information				
School Type	Elementary (PreK thru 4)			
Building Identification	Main Building			
Stories	1			
Building Area	25785 (Gross Square Footage - GSF)			
Year Constructed	1956			
Year of Last Major Renovation	2000			
FCI (Depleted Value)	82.0%			
Environmental & Safety Issues				
Hazardous Materials				
	Asbestos containing materials (ACM)			
HZD Issues are				
	Glue holding tiles to the floor			
Indoor Air Quality (IAQ) Issues				
IAQ Issues include				
IAQ Issues are	·			
IAQ Issues include	-			
Fire or Life/Safety (FL/S) Issues	No			
FL/S Issues are	-			
Other Risk Factors	No			
Other Risk Factors include				
Other Risk Factors are	-			
Handicap Accessibility (ADA) Issues				
Handicap Accessibility (ADA) Issues				
ADA Issues are				
ADA Issues include	N/A			
Utilities - Adequacy	Adaquata			
IT / Internet Service				
Building Wi-Fi Coverage				
Cellular Reception				
Water Service Pressure				
Natural Gas/Propane Pressure				
Electrical Capacity	Adequate			





## 2022 School Facilities Inventory Report

# Facility Name: COLCHESTER SD | PORTERS POINT SCHOOL | 490 PORTERS POINT RD, COLCHESTER 5446 - Elementary (PreK thru 4) - Main Building

					_			_		_
Building Envelope - Roof										
Roof 1 is Single-Ply EPDM/TF										I
Covers 100%	EUL	C-RUL	Cost	/ Unit		Quantity			Total Value	
Installed in 1956	20	-46	\$11.00 /	SF	for	25,785	SF	=	\$283,635	Ń
Roof 2 is -										I
Covers 0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Roof 3 is -										I
Covers 0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for		-	=	\$0	
Roof 4 is -										I
Covers 0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Building Envelope - Windows										
Primary Window System Window, Metal-Fra				/		ō				l
% of Windows That are this Type 100%	EUL	C-RUL	Cost	/ Unit		Quantity	Units	_	Total Value	
Installed in 1956	30	-36	\$60.00 /	SF	for	6,188	SF	=	\$371,304	<u>_!\</u>
Secondary Window System -										I
% of Windows That are this Type 0%	EUL	C-RUL	Cost			Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Services - Elevators										
Primary Conveyance/Elevators None										
Quantity of Stops 0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	(	) -	=	\$0	
Secondary Conveyance/Elevators -										I
Quantity of Stops 0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	(	) -	=	\$0	
Services - Plumbing										
Primary Plumbing System Supply & Sanitary, I				/		<b>A</b>				1
Area of building served 100%	EUL	C-RUL	Cost	/ Unit		Quantity	Units	5	Total Value	
Installed in 1956	40	-26	\$7.00 /	GSF	for	25,785	GSF	=	\$180,495	<u> </u>
Secondary Plumbing System -										1
Area of building served 0%	EUL	C-RUL	Cost			Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Services - Cooling - Central System										
Primary Central Cooling System None										1
Area of building served 0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Secondary Plumbing System -										I
Area of building served 0%	EUL	C-RUL	Cost			Quantity	Units		Total Value	
Installed in -	-	N/A	- /	-	for	-	-	=	\$0	
Services - Heating - Central System										
Primary Heating System Boiler(s)/System - C										1
Area of building served 100%	EUL	C-RUL	Cost	/ Unit		Quantity	Units	5	Total Value	
Installed in 2015	30	23	\$62.00 /	MBH	for	737	MBH	=	\$45,676	
Secondary Heating System -										
Area of building served 0%	EUL	C-RUL	Cost ,	/ Unit		Quantity	Units	5	Total Value	
Installed in -		N/A			for			=	\$0	





## 2022 School Facilities Inventory Report

### Facility Name: COLCHESTER SD | PORTERS POINT SCHOOL | 490 PORTERS POINT RD, COLCHESTER 5446 - Elementary (PreK thru 4) - Main Building

rvices - HVAC Distribution											
Primary HVAC Distribution System Pi	ped System to Unit Ve	ntilators,	/Fan Coils,	2-Pipe System							
Area of building served 10	0%	EUL	C-RUL	Cost /	′Unit		Quantity	Units		Total Value	
Installed in 19	56	30	-36	\$10.00 /	GSF	for	25,785	GSF	=	\$257,850	
Secondary HVAC Distribution System -		ļ					,				
Area of building served 09	6	EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	
Installed in -		-	N/A	- /		for	_	-	=	\$0	
rvices - Package Systems				1		101			+ +	<del>çç</del>	1
Primary HVAC Package Unit & Splits Sp	lit Systems										
Area of building served 10		EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	1
Installed in 19		15	-51	\$2,000.00 /		for	,	TON	=	\$206,280	
Secondary HVAC Package Unit & Splits -	.50	15	51	<i>\$2,000.00  </i>	TON	101	105	TON	-	<i>Ş200,200</i>	
Area of building served 09	4	EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	1
Installed in -	0	LUL	N/A			for	Quantity	Units	=		
		-	IN/A	- /	-	101	-	-	-	\$0	_
rvices - Fire Suppression											
Primary Fire Suppression System No Area of building served 09		ELU	C-RUL	Cost	′ Unit		Quantitu	Unite		Total Value	
Ŭ	0	EUL		Cost /		6	Quantity	Units			
Installed in -		-	N/A	- /	-	for	-	-	=	\$0	
Secondary Fire Suppression System -											
Area of building served 09	6	EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	
Installed in -		-	N/A	- /	-	for	-	-	=	\$0	
rvices - Fire Alarm System				-						u u u u u u u u u u u u u u u u u u u	1
Primary Fire Suppression System M	odern Addressable Fir	e Alarm S	System								
Area of building served 10		EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	
Installed in 20	10	20	8	\$3.00 /		for	25,785		=	\$77,355	
Secondary Fire Suppression System -				,,		1.2.				+,	1
Area of building served 09	6	EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	1
Installed in -	•	-	N/A	- /	-	for		-	=	\$0	
rvices - Security Systems				/		101				ŶŬ	1
Primary Security & Low Volt System Se	curity & Low Voltage S	Systems -	- Average								
Area of building served 10		EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	1
Installed in 20		15	8	\$4.00 /		for	25,785	-	=	\$103,140	
Secondary Security & Low Volt System -	.10	10	Ŭ	<i>Q</i> 1.00 <i>J</i>	001	101	23,703	001		<i>\</i> 100,110	1
Area of building served 09	6	EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	1
Installed in -	U	-	N/A		-	for	Quantity	Onits	=	\$0	
rvices - Electrical Distribution/Infrastructure				- /		101		-		ŞU	
Electrical Distribution/Infrastructure M	ain Distribution Danal	w/Sub D	anals and G	Concrator/UDS	Modium	Donci	h. /				
Area of building served 10		EUL	C-RUL	Cost /		Densi	Quantity	Units		Total Value	
•			C-RUL	-		for			=		
Installed in 20	000	40	18	\$22.00 /	GSF	for	25,785	GSF	=	\$567,270	
rvices - Solar Power (PV)											
Solar (Electric Generation) Provided No	one			Value of Solar P							
Owned/Maintained by School -		<b>E</b> 111	C-RUL			-	0	Linite		Total Value	
Quantity of Panels 0		EUL		Cost /		6	Quantity	Units			
Installed in -		-	N/A	- /	-	for	-	-	=	\$0	
cillary Structures											
Ancillary Structures No	one										
Total SF of Ancillary Structures -		EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	
Installed in -		-	N/A	- /	-	for	-	-	=	\$0	]
Secondary Ancillary Structures -											-
Total SF of Secondary Ancillary Structures 0		EUL	C-RUL	Cost /	′ Unit		Quantity	Units		Total Value	
Installed in -		_	N/A	- /		for			=	\$0	i i

v2022-03-29





### **2022 School Facilities Inventory Report**

Facility Name: COLCHESTER SD | PORTERS POINT SCHOOL | 490 PORTERS POINT RD, COLCHESTER 5446 - Elementary (PreK thru 4) - Main Building

Explanation of Terms	
Projected Capital Planning Cash Flow	The estimated replacement costs of systems as they expire annually.
Facility Condition Index (FCI)	The cost -weighted depleted value of the building compared to the total value of all its systems; overall percent of building useful life consumed by years in service.
Total Value of Assets	The total estimated replacement cost of all the assets listed in the form.
Value of Assets per GSF	The Total Value of all Assets in the form divide by the Gross Square Footage (GSF) of the building.
Facility Condition Index (FCI) Compared to Portfolio	The Facility Condition Index (FCI) of the building overlayed on the chart of FCI's for all buildings in the portfolio. Indicated by a red line in the chart.
Calculated Remaining Useful Life( C-RUL)	The current number of remaining years a system may be expected to perform in designed service.
Expected Useful Life (EUL)	The total number of years a system can be expected to perform in designed service when new.
Gross Square Footage (GSF)	The total square footage contained within the building for all floors/levels.
Cost per Unit	The estimated base cost for a single unit of a system. When multiplied by Quantity results in the total system cost.
Quantity	The amount of a system present in a building. When multiplied by the Cost per Unit results in the total system cost.
Units	The expressed unit of measure for a given system (GSF, EACH, TON, etc).
Ancillary Structures	Buildings on site that are typically known as portables, relocatables or temporary buildings.