




### **2022 School Facilities Inventory Report**

KINGDOM EAST SD | BURKE TOWN SCHOOL | 3293 BURKE HOLLOW ROAD, WEST Facility Name: **BURKE 5871 - Combination - Main Building** 

March 29, 2022

#### Total Value of Assets (Does Not Include Site/Structure/Walls/Interiors) \$1,240,286




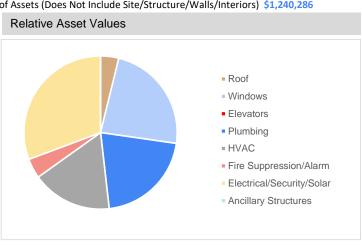

Value of Assets/GSF \$71.69




Site Plan - Google Earth

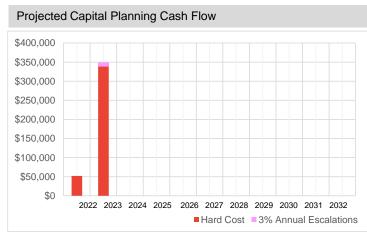



Location Plan - Google Maps

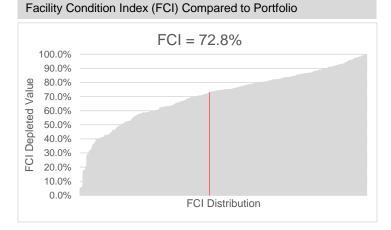

(See Last Page for Explanation of Terms)

v2022-03-29 Page 1 of 5



# BUREAU

## AGENCY OF EDUCATION

#### **2022 School Facilities Inventory Report**

Facility Name: KINGDOM EAST SD | BURKE TOWN SCHOOL | 3293 BURKE HOLLOW ROAD, WEST

**BURKE 5871 - Combination - Main Building** 

**Respondent Information** 

Date/Time Completed 2022-02-15 - 12:34 PM

Respondent Name Danny Pickering
Respondent Title Facilities Manager

Respondent Email dpickering@kingdomeast.org

Respondent Phone Number (802) 626-6100

**Facility Information** 

School Type Combination

**Building Identification Main Building** 

Stories

Building Area 17300 (Gross Square Footage - GSF)

Year Constructed 1978
Year of Last Major Renovation 1994
FCI (Depleted Value) 72.6%

**Environmental & Safety Issues** 

Hazardous Materials Yes

Hazardous (HZD) Materials include Asbestos containing materials (ACM)

HZD Issues are Major

There was a renovation to the building but not the entire building so there is still asbestos in locations that will cost

over 5,000 to remove.

Indoor Air Quality (IAQ) Issues No

IAQ Issues include -

IAQ Issues are -

IAQ Issues include -

Fire or Life/Safety (FL/S) Issues No

FL/S Issues are

Other Risk Factors No

Other Risk Factors include -

Other Risk Factors are -

Handicap Accessibility (ADA) Issues

Handicap Accessibility (ADA) Issues No

ADA Issues are N/A

ADA Issues include N/A

**Utilities - Adequacy** 

IT / Internet Service Marginal

Building Wi-Fi Coverage Adequate

Cellular Reception Marginal

Water Service Pressure Adequate

Natural Gas/Propane Pressure N/A

**Electrical Capacity Adequate** 

Δ

v2022-03-29 Page 2 of 5



# **AGENCY OF EDUCATION**



\$0

## **2022 School Facilities Inventory Report**

Installed in -

Facility Name:	KINGDOM EAST S	D   BU	JRKE T	<b>OWN SCHO</b>	<b>OL   3</b>	293	<b>BURKE H</b>	<b>IOLLO</b>	W P	ROAD, WEST	
	<b>BURKE 5871 - Cor</b>										
	DONKE 3071 - COI	IIIIIIII	LIOII - IV	iaiii bullulli	5						
Building Envelope - Roof	A L II CL: L										
	Asphalt Shingle	EI II	C DIII	Cook	/ 11-26		0	Haiba		T-4-11/-1	
Covers		EUL	C-RUL	Cost	•		Quantity	Units		Total Value	
Installed in		30	2	\$5.50	/ SF	for	8,650	SF	=	\$47,575	
Roof 2 is		5111	6 8111		/			1		T . IV I	
Covers		EUL	C-RUL	Cost	/ Unit		Quantity	Units	4	Total Value	
Installed in		-	N/A	- ,	/ -	for	-	-	=	\$0	
Roof 3 is									_		
Covers		EUL	C-RUL	Cost	/ Unit		Quantity	Units	ш	Total Value	
Installed in		-	N/A	- ,	/ -	for	-	-	=	\$0	
Roof 4 is											
Covers		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- ,	/ -	for	-	-	=	\$0	
Building Envelope - Windows											
Primary Window System									_		
% of Windows That are this Type		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		30	2	\$70.00	/ SF	for	4,152	SF	=	\$290,640	
Secondary Window System											
% of Windows That are this Type	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	-	/ -	for	-	-	=	\$0	
Services - Elevators											
Primary Conveyance/Elevators											
Quantity of Stops	0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		-	N/A	- ,	/ -	for	(	) -	=	\$0	
Secondary Conveyance/Elevators											
Quantity of Stops	0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	-	/ -	for	(	) -	=	\$0	
Services - Plumbing											
Primary Plumbing System	Supply & Sanitary, Media	ım Densi	ity (Includ								
Area of building served	100%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	1994	40	12	\$15.00	/ GSF	for	17,300	GSF	=	\$259,500	
Secondary Plumbing System							•				
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	-	/ -	for	-	-	=	\$0	
Services - Cooling - Central System											
Primary Central Cooling System											
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	-	/ -	for	-	-	=	\$0	
Secondary Plumbing System	-	•					•				
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	-	/ -	for	-	-	=	\$0	
Services - Heating - Central System		_									
Primary Heating System	Boiler(s)/System - Solid F	uel (Wo	od/Pellet)								
Area of building served	100%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	2017	25	20	\$250.00	/ MBH	for	494	MBH	=	\$123,571	
Secondary Heating System	-										
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
						1.			$\Box$	4 -	

v2022-03-29 Page 3 of 5

for



# AGENCY OF EDUCATION



# **2022** School Facilities Inventory Report

Facility Name:	KINGDOM EAST	cn I n	LIDVE T	OWN SCHO	OL 1 22	002	DI IDVE L		A/ D	OAD WEST	
racinty Name.		•			•	195	DUKKE H	OLLO	VV R	OAD, WEST	
	<b>BURKE 5871 - Co</b>	mbina	tion - iv	iain Buildin	g						
Services - HVAC Distribution											
Primary HVAC Distribution System											
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		40	12	\$5.00 /	SF	for	17,300	SF	=	\$86,500	
Secondary HVAC Distribution System											
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	<u> </u>	for	-	-	=	\$0	
Services - Package Systems											
Primary HVAC Package Unit & Splits											
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		-	N/A	- /	<i>'</i> -	for	-	-	=	\$0	
Secondary HVAC Package Unit & Splits	-										
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	<i>'</i> -	for	-	-	=	\$0	
Services - Fire Suppression											
Primary Fire Suppression System	None										
Area of building served	0%	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	<i>'</i> -	for	-	-	=	\$0	
Secondary Fire Suppression System	_	1					l.				
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		-			,	£	Quantity	UTITES			
	<u>-</u>	_	N/A	- /	-	for	_	-	=	\$0	
Services - Fire Alarm System Primary Fire Suppression System	Madara Addrassable Eir	o Alarm	System								
Area of building served				Cost	/ Unit		Quantity	Units		Total Value	
<u> </u>		EUL	C-RUL		•	6			=		٨
Installed in		20	-8	\$3.00 /	SF	for	17,300	3F	=	\$51,900	Ŵ
Secondary Fire Suppression System		5111	C BLII	Cont	/ 11-25		0	I I with a		Taballylahua	
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /		for	-	-	=	\$0	
Services - Security Systems	A.										
Primary Security & Low Volt System		5111	6 814		/ 11 **					T . IV. I	
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		-	N/A	- /	-	for	-	-	=	\$0	
Secondary Security & Low Volt System											
Area of building served		EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	′ -	for	-	-	=	\$0	
Services - Electrical Distribution/Infrastructure											
Electrical Distribution/Infrastructure						Dens					
Area of building served	100%	EUL	C-RUL	Cost	<u> </u>		Quantity	Units		Total Value	
Installed in	1994	40	12	\$22.00 /	GSF	for	17,300	GSF	=	\$380,600	
Services - Solar Power (PV)											
Solar (Electric Generation) Provided											
Owned/Maintained by School				Value of Solar P		-					
Quantity of Panels	0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	<i>'</i> -	for	-	-	=	\$0	
Ancillary Structures											
Ancillary Structures											
Total SF of Ancillary Structures	-	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in	-	-	N/A	- /	<i>'</i> -	for	-	-	=	\$0	
Secondary Ancillary Structures	-	•		·							
Total SF of Secondary Ancillary Structures	0	EUL	C-RUL	Cost	/ Unit		Quantity	Units		Total Value	
Installed in		-	N/A	- /	/ <u>-</u>	for	-	-	=	\$0	
matured in						1.0.	L		11	ΨU	

#### **Additional Comments**

This is just the class room building.

v2022-03-29 Page 4 of 5





## **2022 School Facilities Inventory Report**

Facility Name: KINGDOM EAST SD | BURKE TOWN SCHOOL | 3293 BURKE HOLLOW ROAD, WEST

**BURKE 5871 - Combination - Main Building** 

# **Explanation of Terms**

Explanation of Terms	
Projected Capital Planning Cash Flow	The estimated replacement costs of systems as they expire annually.
Facility Condition Index (FCI)	The cost -weighted depleted value of the building compared to the total value of all its systems; overall percent of building useful life consumed by years in service.
Total Value of Assets	The total estimated replacement cost of all the assets listed in the form.
Value of Assets per GSF	The Total Value of all Assets in the form divide by the Gross Square Footage (GSF) of the building.
Facility Condition Index (FCI) Compared to Portfolio	The Facility Condition Index (FCI) of the building overlayed on the chart of FCI's for all buildings in the portfolio. Indicated by a red line in the chart.
Calculated Remaining Useful Life( C-RUL)	The current number of remaining years a system may be expected to perform in designed service.
Expected Useful Life (EUL)	The total number of years a system can be expected to perform in designed service when new.
Gross Square Footage (GSF)	The total square footage contained within the building for all floors/levels.
Cost per Unit	The estimated base cost for a single unit of a system. When multiplied by Quantity results in the total system cost.
Quantity	The amount of a system present in a building. When multiplied by the Cost per Unit results in the total system cost.
Units	The expressed unit of measure for a given system (GSF, EACH, TON, etc).
Ancillary Structures	Buildings on site that are typically known as portables, relocatables or temporary buildings.

v2022-03-29 Page 5 of 5