


ROUTINE PERFORMANCE CHECK REPORT

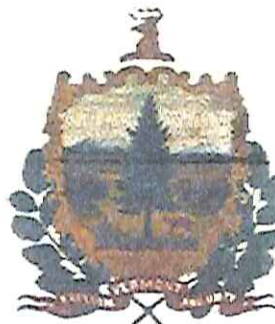

DataMaster DMT: 100151
Location: Newport PD
Calibration Date: 10/07/2011
Certification Date: 10/12/2011
Installation Date: 10/25/2011
RPC Date: 10/02/2015
Supervisor Name: CHARLES D MOULTON

Diagnostic Results

VERSIONS
DMT: 1.01
PIC: 2.05
Modem: 2.4
Questions: 2.1

TEMPERATURES

Sample Chamber = 48.7°C
Breath Tube = 45.3°C
Digital Sim = 34.1°C

SETTINGS

Lamp Voltage = 1.68 V
Cooler Voltage = 1.69 V
Bias Voltage = 80 V
Chopper Freq = 545 Hz

PUMP INFO

Flow Rate = 6.016 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX (V)	0.2659	0.2697
MIN (V)	0.2646	0.2683

FILTER INFO

Filter 1	0.269	Zero = true
Filter 2	0.592	Zero = true
Filter 3	1.309	Zero = true

CALIBRATION CHECK

Xq = 0.086 1.75%

Routine Performance Check Passed

Accuracy and Precision Check


Concentration	= 0.098 g/210L
Lot #	= 15-01-100
Range	= 0.093 - 0.103
Average	= 0.098 g/210L
Std Dev	= 0.0000

RF Detection Test

Passed

Sample Acceptance Test

Passed

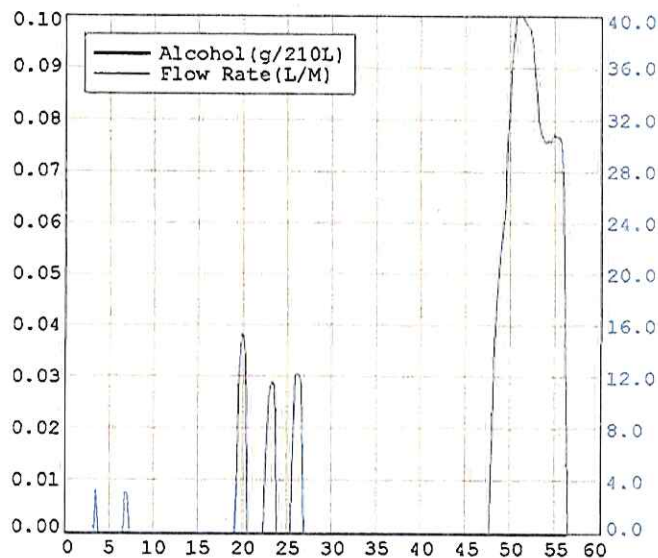

Performed by

[Signature]

Date

10/02/2015

Reviewed by

[Signature]

Date

10/5/15

DMT Serial Number #100151

Page 1 of 1

10/02/2015 6:55 PM