

INSTALLATION REPORT

DataMaster DMT: 100156
Location: FAIR HAVEN PD
Calibration Date: 06/09/2021
Certification Date: 06/09/2021
Installation Date: 06/11/2021
Installed by: SARAH STRATTON



Default Options Loaded

Diagnostic Results

VERSIONS
DMT: 2.06
PIC: 3.07
Modem: 2.6
Questions: 2.1

TEMPERATURES

Sample Chamber = 48.8°C
Breath Tube = 46.7°C
Digital Sim = 34.0°C

SETTINGS

Lamp Voltage = 1.62 V
Cooler Voltage = 1.66 V
Bias Voltage = 80 V
Chopper Freq = 520 Hz

PUMP INFO

Flow Rate = 5.524 L/M

DETECTOR INFO

PUMP	ON	OFF
MAX (V)	-0.0398	-0.0346
MIN (V)	-0.0415	-0.0358

FILTER INFO

Filter	Value	Zero
Filter 1	-0.035	true
Filter 2	0.260	true
Filter 3	0.918	true

CALIBRATION CHECK

Xq = 0.107 0.33%

INSTALLATION PASSED

Accuracy and Precision Check


Concentration	= 0.101 g/210L
Lot #	= 20-10-100
Range	= 0.096 - 0.106
Average	= 0.100 g/210L
Std Dev	= 0.0007

RF Detection Test

Passed
RF detected

Sample Acceptance Test

Passed

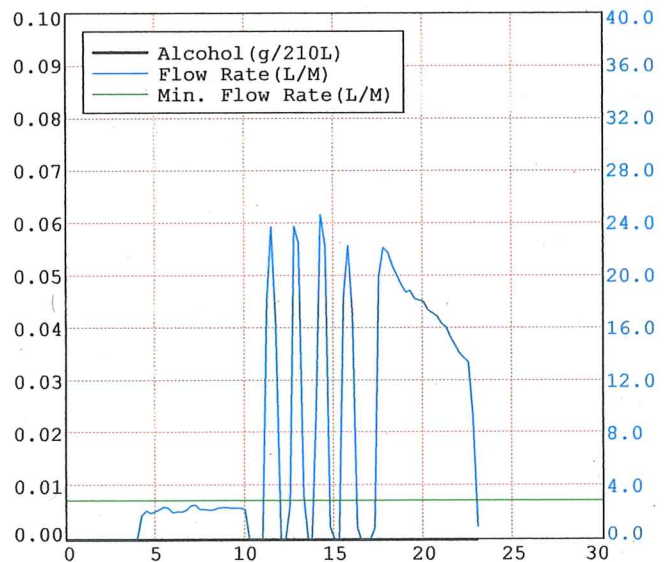

Performed by

SJS

Date

06/11/2021

Reviewed by

[Signature]

Date

6/14/21

DMT Serial Number #100156

Page 1 of 1

06/11/2021 2:21 PM

100156

SJS

Page 1 of 2

INSTALLATION REPORT

DataMaster DMT: 100156
Location: FAIR HAVEN PD
Calibration Date: 06/09/2021
Certification Date: 06/09/2021
Installation Date: 06/11/2021
Installed by: SARAH STRATTON



Default Options Loaded

Diagnostic Results

VERSIONS

DMT: 2.06
PIC: 3.07
Modem: 2.6
Questions: 2.1

TEMPERATURES

Sample Chamber = 48.9°C
Breath Tube = 46.9°C
Digital Sim = 34.0°C

SETTINGS

Lamp Voltage = 1.63 V
Cooler Voltage = 1.66 V
Bias Voltage = 80 V
Chopper Freq = 520 Hz

RF Detected

Adjusted RF detection limits in the tech screen and re-ran the install. SDS 6/14/2021

INSTALLATION FAILED

Performed by

SDS

Date

06/11/2021

Reviewed by

Date