INSTALLATION REPORT

DataMaster DMT: 121606
Location: Windham County SO
Calibration Date: 08/22/2011
Certification Date: 08/22/2011
Installation Date: 09/07/2011
Installed by: STEVEN E HARNOIS

Site meets specification in doc P-ALC-210

Default Options Loaded

Diagnostic Results

```
VERSIONS
DMT: 1.00
PIC: 2.05
Modem: 2.1
Questions: 2.0

TEMPERATURES

Sample Chamber = 49.0°C
Breath Tube    = 47.4°C
Digital Sim    = 34.0°C

SETTINGS
Lamp Voltage   = 1.67 V
Cooler Voltage = 1.79 V
Bias Voltage   = 80 V
Chopper Freq   = 541 Hz

PUMP INFO
Flow Rate = 4.611 L/M

DETECTOR INFO
PUMP     ON         OFF
MAX(V)    0.0886     0.0911
MIN(V)    0.0872     0.0894

FILTER INFO
Filter 1   0.090  Zero = true
Filter 2   0.857  Zero = true
Filter 3   1.397  Zero = true

CALIBRATION CHECK
Xq  = 0.126  0.35%
```

Accuracy and Precision Check

Concentration	= 0.101 g/210L
Lot #	= 11-41-100
Range	= 0.096 - 0.106
Average	= 0.101 g/210L
Std Dev	= 0.0000

RF Detection Test

Passed

Sample Acceptance Test

Passed

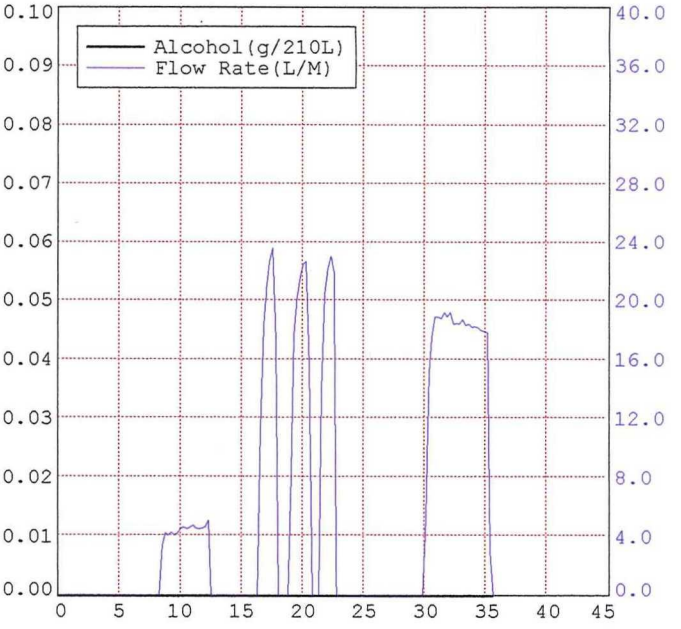

INSTALLATION PASSED

Performed by _____ Date 09/07/2011

Reviewed by _____ Date 09/07/11 Rev. 9-8-11

INSTALLATION REPORT

DataMaster DMT: 121606
Location: Windham County SO
Calibration Date: 08/22/2011
Certification Date: 08/22/2011
Installation Date: 09/07/2011
Installed by: STEVEN E HARNOIS

Site meets specification in doc P-ALC-210

Default Options Loaded

Diagnostic Results

```
VERSIONS
DMT: 1.00
PIC: 2.05
Modem: 2.1
Questions: 2.0

TEMPERATURES

Sample Chamber = 48.7°C
Breath Tube    = 46.5°C
Digital Sim    = 34.0°C

SETTINGS
Lamp Voltage   = 1.67 V
Cooler Voltage = 1.79 V
Bias Voltage   = 80 V
Chopper Freq   = 541 Hz

PUMP INFO
Flow Rate = 4.630 L/M

DETECTOR INFO
PUMP     ON          OFF
MAX(V)    0.0699      0.0732
MIN(V)    0.0689      0.0722

FILTER INFO
Filter 1   0.073  Zero = true
Filter 2   0.842  Zero = true
Filter 3   1.380  Zero = true

CALIBRATION CHECK
Xq  = 0.126  0.00%
```

Accuracy and Precision Check

Concentration	= 0.101 g/210L
Lot #	= 11-41-100
Range	= 0.096 - 0.106
Average	= 0.101 g/210L
Std Dev	= 0.0000

RF Detection Test

Passed

SH 9/8/11

Sample Acceptance Test

Failed

Alcohol .001 SH 09/07/11 9-8-11

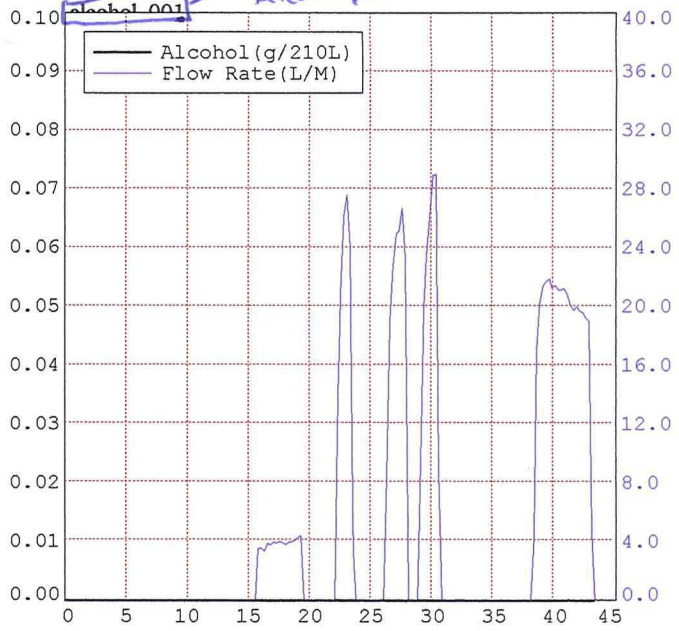

INSTALLATION FAILED

Performed by _____ Date 09/07/2011 Rev. KLK 9-8-11

Reviewed by _____ Date 09/07/11

INSTALLATION REPORT

DataMaster DMT: 121606
Location: Windham County SO
Calibration Date: 08/22/2011
Certification Date: 08/22/2011
Installation Date: 09/07/2011
Installed by: STEVEN E HARNOIS

Site meets specification in doc P-ALC-210

Default Options Loaded

Diagnostic Results

```
VERSIONS
DMT: 1.00
PIC: 2.05
Modem: 2.1
Questions: 2.0

TEMPERATURES

Sample Chamber = 48.7°C
Breath Tube    = 47.6°C
Digital Sim    = 34.0°C

SETTINGS
Lamp Voltage   = 1.66 V
Cooler Voltage = 1.79 V
Bias Voltage   = 80 V
Chopper Freq   = 543 Hz

PUMP INFO
Flow Rate = 4.559 L/M

DETECTOR INFO
PUMP     ON         OFF
MAX(V)    0.0435     0.0465
MIN(V)    0.0417     0.0453

FILTER INFO
Filter 1   0.046  Zero = true
Filter 2   0.819  Zero = true
Filter 3   1.354  Zero = true

CALIBRATION CHECK
Xq  = 0.126  0.21%
```

Accuracy and Precision Check

Concentration = 0.101 g/210L
Lot # = 11-41-100
Range = 0.096 - 0.106
Average = 0.100 g/210L
Std Dev = 0.0000

RF Detection Test

Passed

Sample Acceptance Test

Failed

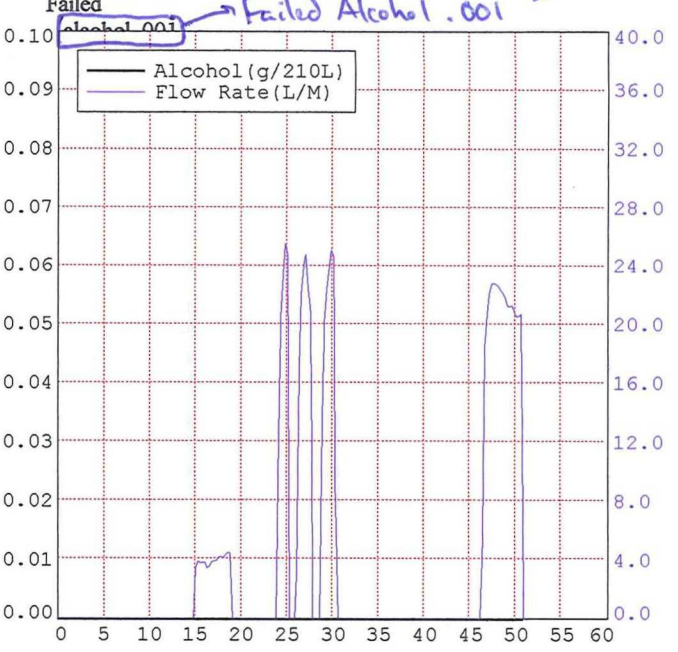

INSTALLATION FAILED

Performed by _____ Date 09/07/2011

Reviewed by _____ Date 09/07/11